


| SPECIFICATION | CONNECTION | BIPOLAR |
|---|------------|-----------------------------------|
| AMPS/PHASE | | 1.68 |
| RESISTANCE/PHASE(Ohms)@25°C | | 1.80±10% |
| INDUCTANCE/PHASE(mH)@1KHz | | 3.20±20% |
| HOLDING TORQUE w/o GEARBOX(Nm)[lb-in] | | 0.52[4.60] |
| GEAR RATIO | | 13 ²¹ / ₂₈₉ |
| EFFICIENCY | | 80.00% |
| STEP ANGLE w/o GEARBOX(°) | | 1.80 |
| BACKLASH@NO-LOAD | | <=3° |
| MAX.PERMISSIBLE TORQUE(Nm) | | 3.00 |
| MOMENT PERMISSIBLE TORQUE(Nm) | | 5.00 |
| SHAFT MAXIMUM AXIAL LOAD(N) | | 50.00 |
| SHAFT MAXIMUM RADIAL LOAD(N) | | 100.00 |
| WEIGHT(Kg)[lb] | | — |
| TEMPERATURE RISE:MAX.80°C (MOTOR STANDSTILL;FOR 2PHASE ENERGIZED) | | |
| AMBIENT TEMPERATURE -10°C~50°C[14°F~122°F] | | |
| INSULATION CLASS B 130°C[266°F] | | |

| TYPE OF CONNECTION (EXTERN) | | MOTOR | |
|-----------------------------|---------|-------|---------|
| PIN NO | BIPOLAR | LEADS | WINDING |
| 1 | A+ — | BLK | |
| 2 | A- — | GRN | |
| 3 | B+ — | RED | |
| 4 | B- — | BLU | |

FULL STEP 2 PHASE-Ex. ,
WHEN FACING MOUNTING END (X)

| STEP | A+ | B+ | A- | B- | | CCW |
|------|----|----|----|----|--|-----|
| 1 | + | + | - | - | | |
| 2 | - | + | + | - | | |
| 3 | - | - | + | + | | |
| 4 | + | - | - | + | | |

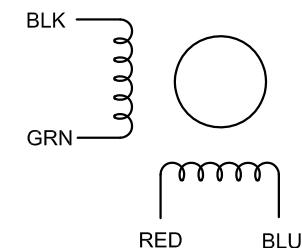

STEPPERONLINE®

| | | | |
|-------|-----------|--|----------|
| | APVD | | 1.5.2023 |
| | CHKD | | |
| 1:1 | DRN | | |
| SCALE | SIGNATURE | | DATE |

STEPPER MOTOR

17HS19-1684S-PG14